

Technical Bulletin

Model
928 S4/GT
911 C2/4, 944 S2

Group
7

Subject: **Seat Rail Stop Modified**

Part Identifier
7284

Number
9003

ATTENTION: Service Manager/Service Technician

Models Affected: **911 Carrera 2/4**
 928 S4/GT
 944 S2

Concern: Electric seat jammed in backward stop position. Electric seat motor not powerful enough to pull seat from stop.

Vehicle Information: The stop washers on the seat rail threaded rod are modified (harder material). The color of the new washer is white (previously light brown).

From production date: June 5, 1990.

Service Information: The stop washers are not available as spare parts. If a seat is jammed in the backward stop position on earlier production cars, cut the stop washer with a side cutter or similar tool and discard. Move seat at least five times against the backward stop position with someone sitting in the seat. If the seat still jams, replace outer seat rail.

Parts Information: Left Seat Outer Rail: Part Number 928 521 489 08
 Right Seat Outer Rail: Part Number 928 521 490 08

ADDITIONAL INFORMATION

Dealership Service manager _____ Shop foreman _____ Service technician _____
Distribution Asst. manager _____ Warranty admin. _____ Service technician _____
Routing

© 1990 Porsche Cars North America, Inc.
All rights reserved. Cannot be reproduced without written permission.
Porsche Technical Publications



SERVICE

Page 1 of 1
December 14, 1990