

Technical Bulletin

Model
911 C2/C4

Group
3

Subject: Stiff Clutch Actuation-
High Pedal Effort

Part Identifier
3056

Number
9301

ATTENTION: Service Manager/Service Technician

Models Affected: 1990 to 1992 Carrera 2/4 (L, M, N)

Concern: Clutch pedal stiff or hard to depress.

General Information: Extensive investigation of clutch components which were replaced for stiff clutch actuation has produced the following results:

A 90% reduction in clutch pedal force was achieved by replacing only the clutch disc. Only in cases of high mileage, pronounced wear or serious corrosion should all the clutch parts and actuation elements be considered for replacement.

Repair Information: As a result, the following procedure should be used before replacing clutch parts for **stiff clutch actuation**. (High pedal effort.)

1. Bleed the clutch hydraulics.
2. Check pedal operation. (See Technical Bulletin Group 3, Number 9202.)
3. Check clutch and operating parts for serious wear or corrosion. (Some wear and light corrosion is considered normal.)
4. Replace clutch disc.

Vehicle Information: As of August 24, 1992, from engine number 62 P 010678, clutch disc Part Number 964 116 013 50 is installed in production. This part should be installed if disc replacement becomes necessary.

Parts Information: Clutch disc: Part Number 964 116 013 50

