

# Technical Bulletin

**Model**  
911C2/C4

**Group**  
5

**Subject:** Front Fenders Tack-Welded

**Part Identifier**  
5055

**Number**  
9001


**ATTENTION: Service Manager/Service Technician**

**Models Affected:** *911 Carrera 2 and 911 Carrera 4*

**Concern:** Front fenders are tack-welded in production.

**Repair Information:** When removing fenders, check for tack-welds and detach as necessary (maximum two weld points, "X" in figure).

When installing fenders, to ease installation and alignment, you may also tack-weld in the areas indicated by "X" in figure.

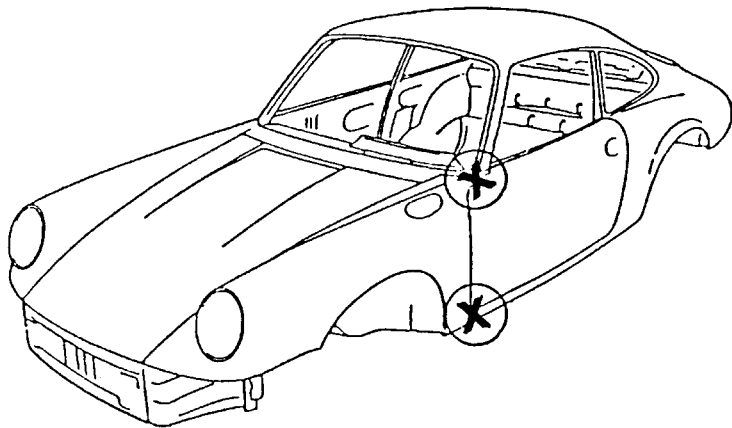

PORSCHE CARS NORTH AMERICA - 20

Dealership _____	Service manager _____	Shop foreman _____	Service technician _____
Distribution _____	Asst. manager _____	Warranty admin. _____	Service technician _____
Routing _____			

©1990 Porsche Cars North America, Inc. All Rights Reserved Technical Support Department



# SERVICE

Page 1 of 1  
May 29, 1990