

Technical Bulletin

Model
911 C2/C4

Group
8

Subject: A/C Hose Securing

Part Identifier
8743/45

Number
9003

ATTENTION: Service Manager/Service Technician

Models Affected: 911 Carrera 2 and 911 Carrera 4

Concern: A/C hoses in the engine compartment contact the ventilation screen of the rear spoiler.

Vehicle Information: The high and low pressure A/C hoses in the engine compartment are secured to the intake manifold with a retainer and support (Figure 1).

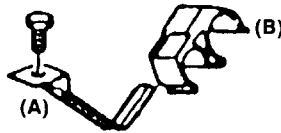


Figure 1



Figure 2

From VIN: 96 _ MS 41 0073 - Coupe
96 _ MS 44 0062 - Targa
96 _ MS 46 0063 - Cabriolet

Repair Information: The new mounting bracket and retainer (Figures 1 & 2) can be installed in 911 Carrera 2/4 prior to the above VIN's. The spacing rubber must be removed from the A/C hose.

Parts Information: The following parts are required when modifying A/C hose securing:

- 1 x 964 573 473 00 Retainer (A)
- 1 x 964 573 471 00 Support for low/high pressure hose (B)
- 1 x 964 110 548 01 Bracket on manifold (C)
- 1 x N 010 210 13 Bolt M6 x 10

Warranty Claim Information: Labor Operation: 8743190A
Damage Code: 8743180002
Time Units: 50

ADORSUHEM SPAS NORHTI A MERICAI NZC .

Dealership _____	Service manager _____	Shop foreman _____	Service technician _____	_____	_____	_____
Distribution _____	Asst. manager _____	Warranty admin. _____	Service technician _____	_____	_____	_____
Routing _____						

© 1990 Porsche Cars North America, Inc. All rights reserved. Cannot be reproduced without written permission. Porsche Technical Publications



SERVICE

Page 1 of 1
December 14, 1990