

Technical Bulletin

Model
911 C2

Group
4

Subject: Rear Springs and Stabilizer

Part Identifier
4290

Number
9208


ATTENTION: Service Manager/Service Technician

Models Affected:

911 Carrera 2, model year 1992 and 1993
From 963 NS 420459 to 967 PS 420144
96X NS 440177 to 966 PS 440082
961 NS 460497 to 962 PS 460155

Concern:

A limited number of 1992 and 1993 911 Carrera 2 vehicles were produced with a rear stabilizer bar which measures 21mm in diameter and rear springs with orange color coding. It is very important that when repairing these vehicles, you must be sure that the same parts are installed on these vehicles as originally equipped.

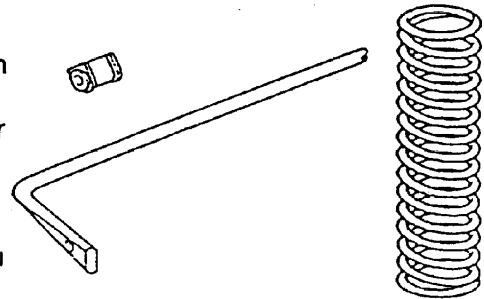

Repair Information:

When performing any repairs to the rear suspension of any 1992 or 1993 911 Carrera 2 vehicle, always measure the rear stabilizer with a caliper and visually check the color coding of the rear springs. This will help assure the repair is done properly and will also help prevent reordering parts.

Parts Information:

Rear coil spring set (orange)	Part Number 964 333 531 04 504
Rear stabilizer bar (21mm dia.)	Part Number 964 333 701 07
Rear stabilizer bushings	Part Number 477 411 313 D

Warranty Information:

Labor Operations:			Time Units:
4271 1903	R & R	1 Strut	80
4271 2000	R & R	2 Struts	120
4272 1950	R & R	1 Spring	50
4272 2050	R & R	2 Springs	80
4290 1900	R & R	Stabilizer bar	90
4291 5500	R & R	1 Stabilizer mounting	40
4291 5600	R & R	2 Stabilizer mountings	60

PORSCHE CARS NORTH AMERICA INC.

